

Work Order ID 132352

Thursday, May 07, 2015 12:46:37 PM

132352

Page 1

Item ID: D206-667-247TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Assembly, Mid Aft

Start Date: 5/7/2015 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 5/7/2015 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: MCS Date: MAY 07 2015

Tooling:

Date:

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D206-667-247	A
--------------	---

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DTxxxx on both ends as per Folio FB030

2-Turn first side as per Folio FB030

3-File down transition lines smooth.

FOLIO REV: AADWG REV: A

1 0

mmml
15/06/09

110

QC1- Inspection performed by CMM

0.00

110

QC

Memo

0.00

Quality Control

1 0

mmml
15/06/09

DQA:

Date:

15/09/02



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed

Date:

15/08/02

Work Order update only

Work Order: <u>132352</u>		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. <u>D206-667-247TRN</u>		Rework ☐		Skid-tube ☐		Cross tube ☒		Water Jet ☐		Engineering ☐	
NCR No. <u>15-5273</u>		Scrap ☐		Machining ☐		Small Fab ☐		Prod. Eng. Coord. ☐		Quality ☐	
		Use-as-is ☒		Thermoforming ☐		Finishing ☐		Rec/Store/Packaging ☐		Other ☐	
		Suspected Unapproved ☐		Large Fab ☐		Composite ☐		Supplier ☐			
Date: <u>15/6/26</u>		Step #: <u>110</u>		QTY Effective: <u>①</u>				MRB (QSI042) Approval DAS 12 15/6/26			
Description Work Order Deviation				Disposition				Completed By			
Ultrasonic wall measurements are over tolerance. Min wall is 0.027 under tolerance, which is within allowable eccentricity of new mat'l.				Acceptable				JW 15-07-02 Lead hand / Supervisor Approval Verification JW 15-07-02 DAS 38 QC / Production Approval AD 15-07-02			
Root Cause				FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐						
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐						
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	☒ Over/Under tolerance						
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐						
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐						
Material ☒	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐						
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐						
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐						
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐						
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐						
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :									
Misidentified ☐	Past Due ☐										

Work Order ID 132352

Thursday, May 07, 2015 12:46:37 PM

132352

Page 2

Item ID: D206-667-247TRN Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Crosstube Assembly, Mid Aft
 Start Date: 5/7/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 5/7/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120 *120* Mori Seiki Mori Seiki CNC Lathe Large	MORI SEIKI CNC LATHE LARGE Memo 1-Turn second side as per Folio FB030 2-File down transition lines smooth. 3-Remove sand and plugs FOLIO REV: <u>GA</u> DWG REV: <u>A</u>	0.00 0.00				1	Ø		mmL 15/06/09
130 *130* QC Quality Control	QC1- Inspection performed by CMM Memo	0.00 0.00				1	Ø		mmL 15/06/09
140 *140* QC Quality Control	QC8- Inspect parts - second check Memo	0.00 0.00				1	Ø		DAS 47 9-89 15-07-02

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 132352

Thursday, May 07, 2015 12:46:37 PM

132352

Page 3

Item ID: D206-667-247TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Assembly, Mid Aft
Start Date: 5/7/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/7/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
145		0.00							
145									
Crosstubes	Memo	0.00							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								
160	QC5- Inspect part completeness to step on W/O	0.00							
160									
QC	Memo	0.00							
Quality Control									

B2 15/07/103

B2 15/08/20

① 1508-20 DAS
9
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 132352

Thursday, May 07, 2015 12:46:37 PM

132352

Page 4

Item ID: D206-667-247TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Assembly, Mid Aft
Start Date: 5/7/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/7/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170		0.00							
170	Packaging					BL		15/08/21	
Packaging	Memo	0.00							
Packaging	LOCATION : LG014								
180		0.00							
180	QC21- Final Inspection - Work Order Release								
QC	Memo	0.00				MLS		AUG 2 1 2015	
Quality Control									

20150821 *SB*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																		
Large Fab ☐	Composite ☐	Supplier ☐																			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval																	
Description Work Order Deviation		Disposition		Completed By																	
				Lead hand / Supervisor Approval Verification																	
				QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																
OTHER : ☐																					

Picklist Print

Thursday, May 07, 2015 12:46:41 PM

Page 1

Work Order ID: 132352

132352

Parent Item: D206-667-247TRN

D206-667-247TRN

Parent Item Name: Crosstube Assembly, Mid Aft

Start Date: 5/7/2015

Required Date: 5/7/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP rev:A 11.01.06 new issue DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6004-115		Manufactured	No			100	Each	123.0000	1	1			

D6004-115

Crosstube Material

Location	Loc Qty	Loc Code
LG	33	
107870	33	
LG003	90	
107869	39	
116116	41	
34685	1	
75636	9	

_____ L mml 15/06/08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			


DART AEROSPACE LTD	Work Order: 132352
Description: Crosstube Assembly, Mid Aft	Part Number: D206-667-247
Inspection Dwg: D206-667-247 Rev: A	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.492	/	vern	CNC-08
	2.025	+0.005/-0.000	2.027	/	↓	
	2.079	+0.005/-0.000	2.082	/		
	2.145	+0.005/-0.000	2.149	/		
	2.209	+0.005/-0.000	2.212	/		
	2.287	+0.005/-0.000	2.289	/		
	2.363	+0.005/-0.000	2.366	/	↓	
	0.200	+/-0.010	.200	/	vern	CNC-08
	R0.063	+/-0.010	.063	/	R6	
	R2.00	+/-0.010	2.00	/	"	
	R0.063	+/-0.010	.063	/	"	
	4.438	+/-0.010	4.440	/	vern	CNC-08
SIDE B	2.490	+0.005/-0.000	2.493	-	vern	CNC-08
	2.025	+0.005/-0.000	2.030	-	↓	
	2.079	+0.005/-0.000	2.084	-		
	2.145	+0.005/-0.000	2.149	-		
	2.209	+0.005/-0.000	2.214	-		
	2.287	+0.005/-0.000	2.289	-		
	2.363	+0.005/-0.000	2.364	/	↓	
	0.200	+/-0.010	.200	-	vern	CNC-08
	R0.063	+/-0.010	.063	-	R6	
	R2.00	+/-0.010	2.00	/	"	
	R0.063	+/-0.010	.063	/	"	
	4.438	+/-0.010	4.440	/	vern	CNC-08
	99.76	+/-0.020	99.76	/	tape	h6-11

DART AEROSPACE LTD		Work Order: 132352
Description: Crosstube Assembly, Mid Aft		Part Number: D206-667-247
Inspection Dwg: D206-667-247 Rev: A		Page 2 of 2

WALL THICKNESS MEASUREMENT

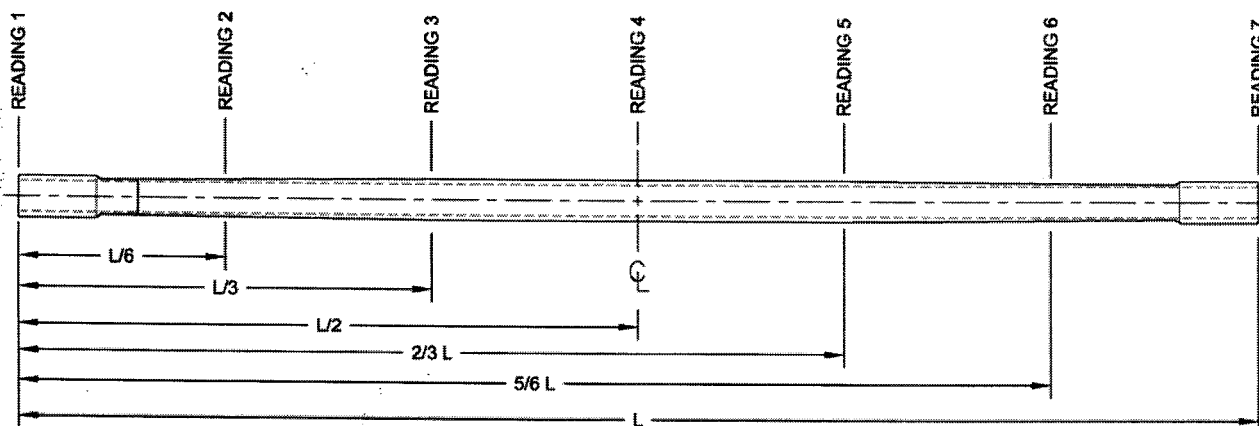

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.357	.328	.347	.377	.049	0.045"
READING 2 L= 17	.207	.172	.182	.215	.043	
READING 3 L= 33	.337	.305	.326	.357	.052	
READING 4 L= 50	.357	.322	.349	.384	.062	
READING 5 L= 67	.334	.301	.320	.352	.051	
READING 6 L= 83	.198	.173	.196	.211	.038	
READING 7 L= 99	.347	.318	.354	.384	.066	

Δw Δ
 0.345 0.017
 0.327 0.022
 0.350 0.028
 0.327 0.026
 0.345 0.027

Calibration Result

Actual Block Thickness: .100 - .250

Situscan 250 Measured Thickness: .100 - .250

JAS
47

Measured by: <i>mmml</i>
Date: 15/06/09

Audited by: 3-89
Date: 15-07-02

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	11.06.21	New Issue	KJ	
B	12.02.02	Dimension 4.438 was 4.500	KJ	
C	12.06.01	Wall thickness form added	KJ	

Item	Qty -247	Part Number	Description
1	X	D206-667-247	CROSSTUBE ASSEMBLY (206L MID AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 99.76±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-247" AND BATCH NUMBER ON
INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS).
- 7) WEIGHT: 21.1 lbs (-607 = 17.7 lbs)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI
015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE
D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE
LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

132352 MLC
150507

DEO ATTACHED

BCO #11-615

11.07.28

UNDER REVIEW


4/11/08.13

RELEASED
2011-05-24

A	NEW ISSUE	CP	10.12.23
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.12.23		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D206-667-247	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASS'Y (206L MID AFT)	SCALE NTS


COPYRIGHT © 2010 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD

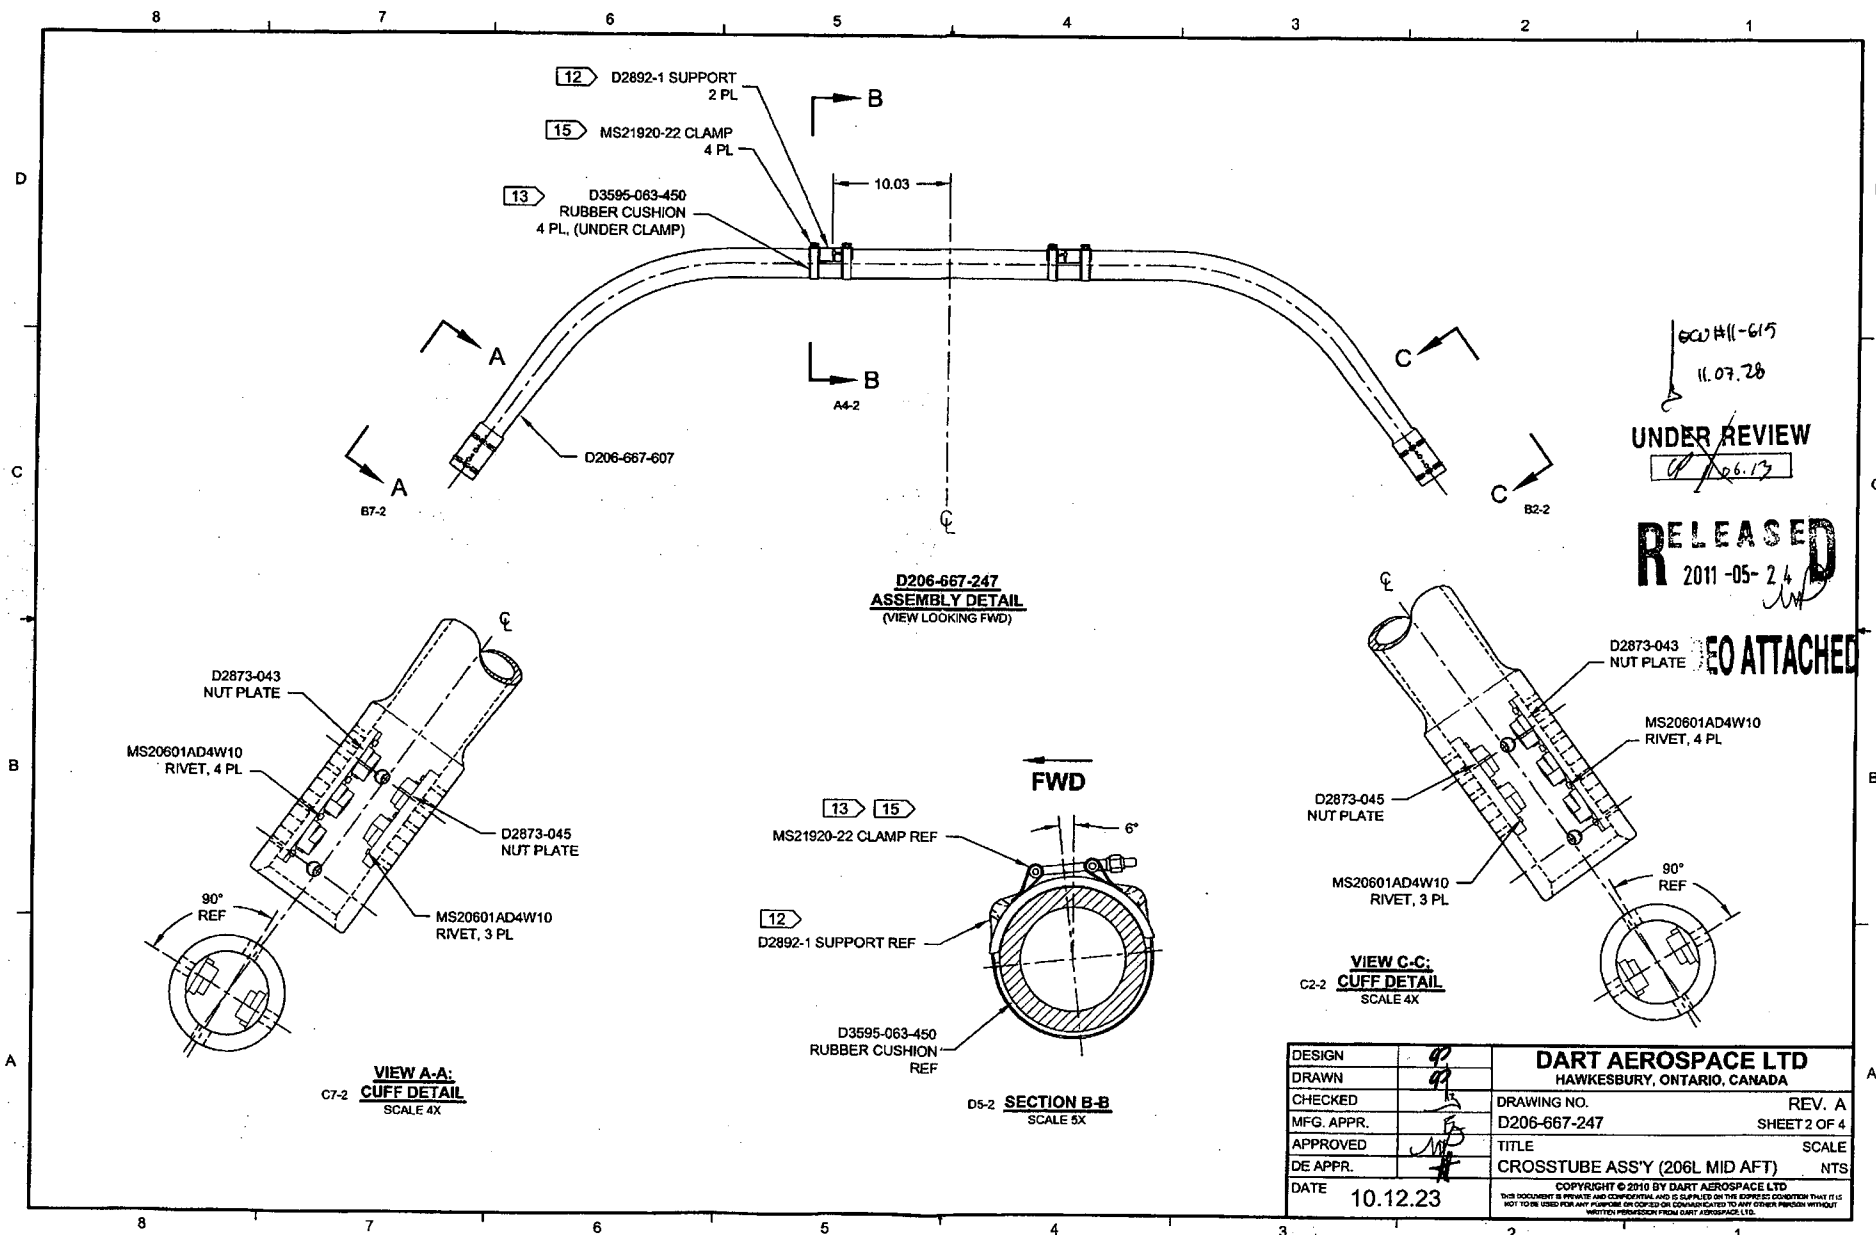


UNDER REVIEW

RELEASED
2011-05-24


EO ATTACHED

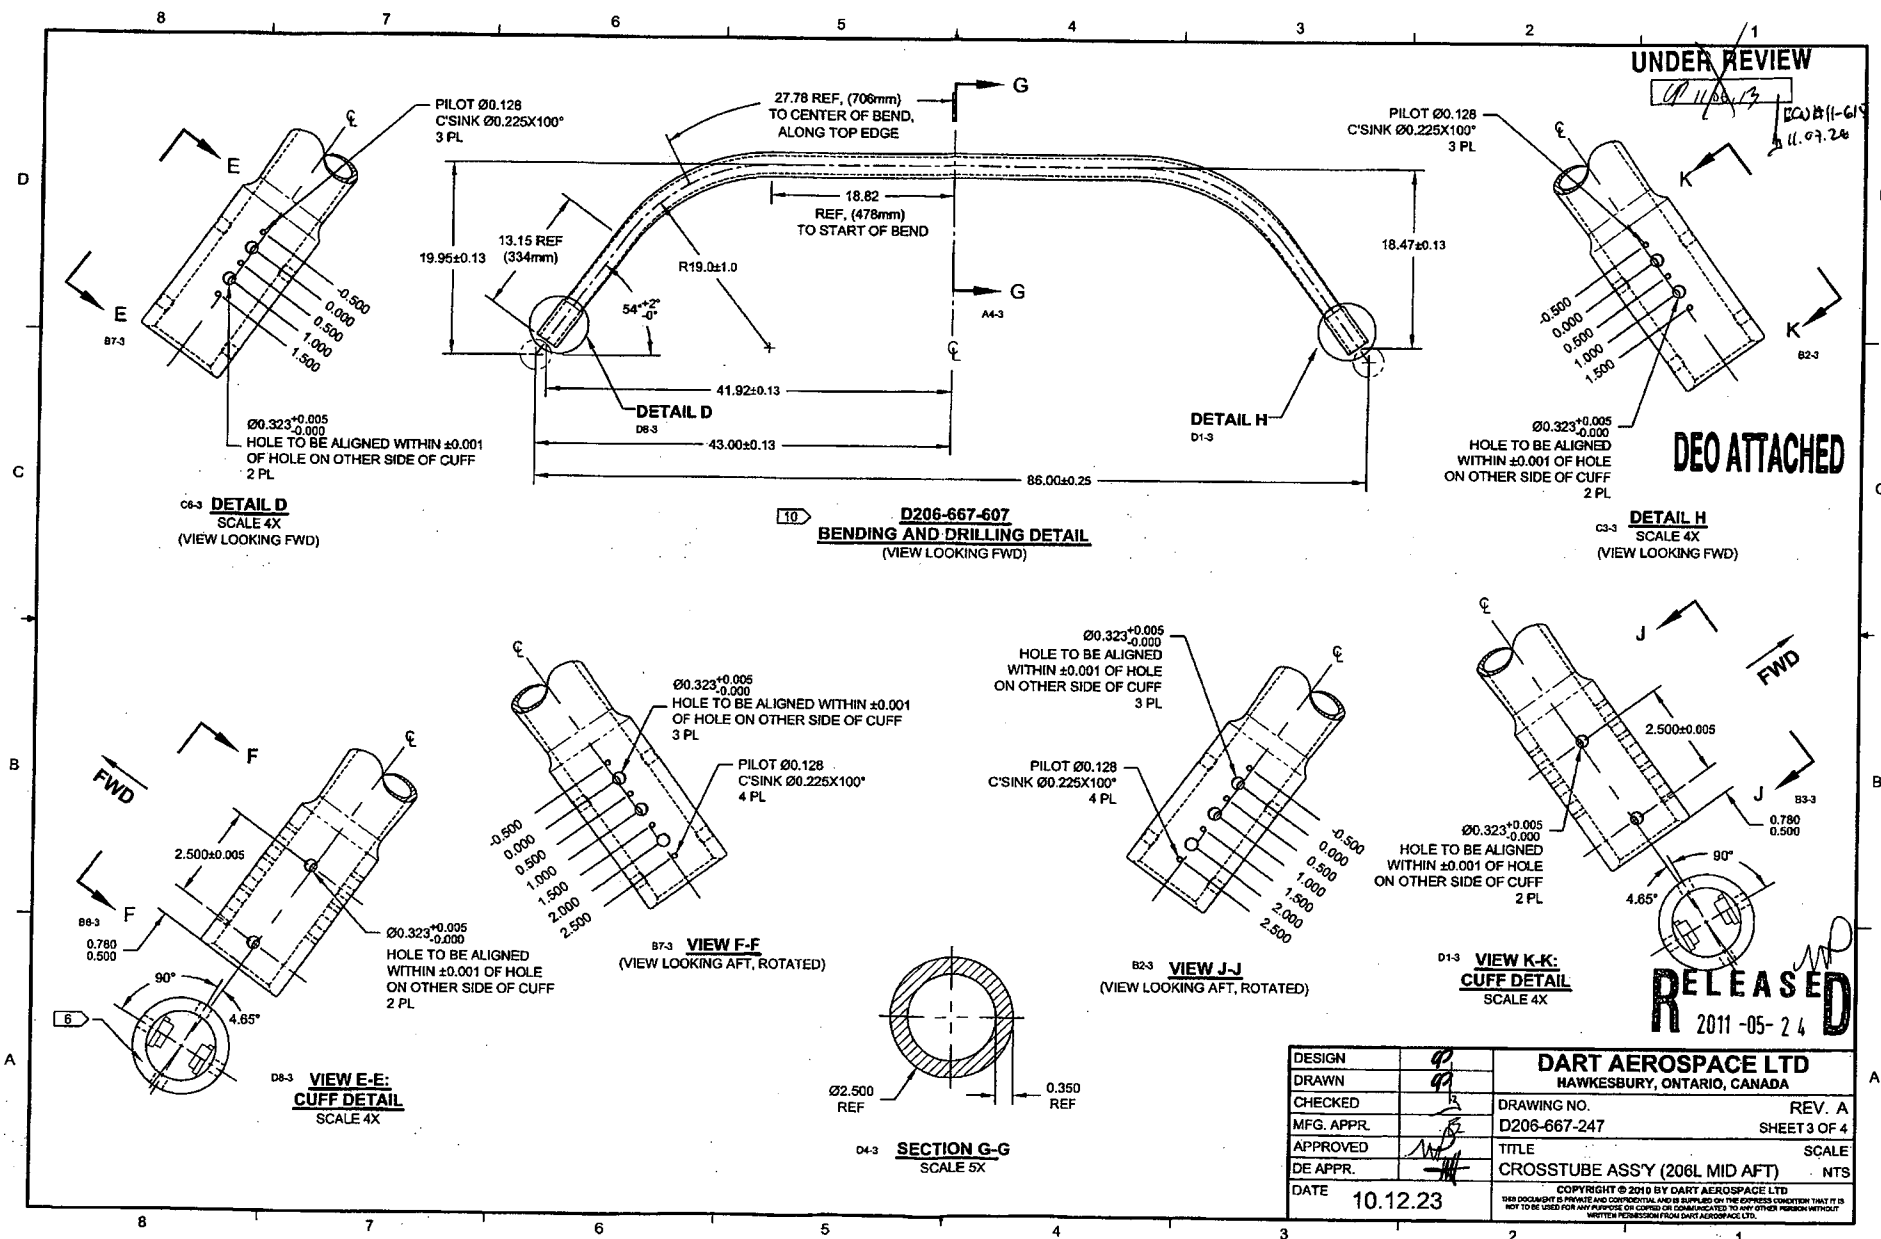


SEE DETAIL L
B7-4

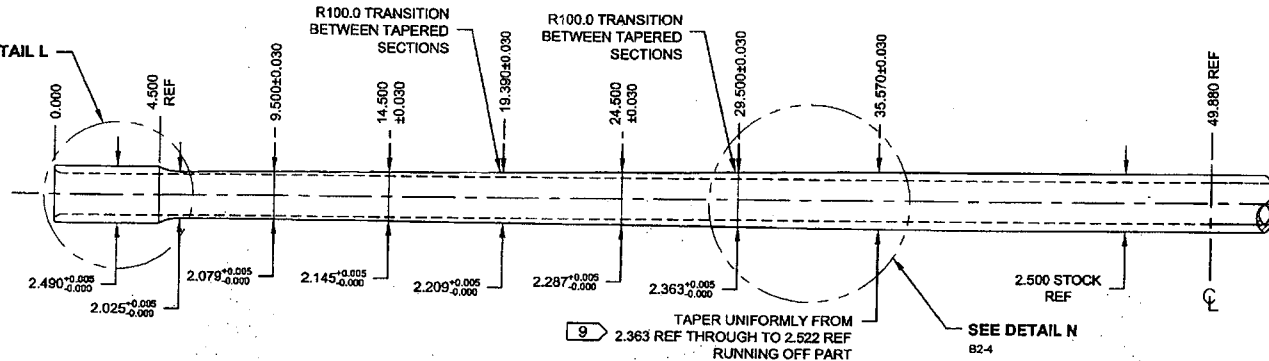


TURNING DETAIL

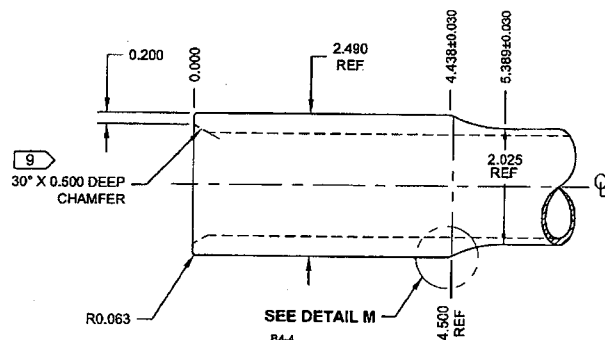

C7-4 **DETAIL L: CROSSTUBE CUFF**
SCALE 2.5X

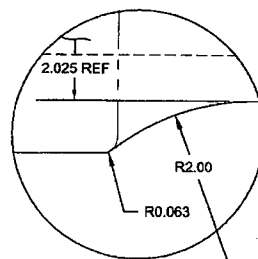

B6-4 **DETAIL M: CUFF TRANSITION**
NOT TO SCALE

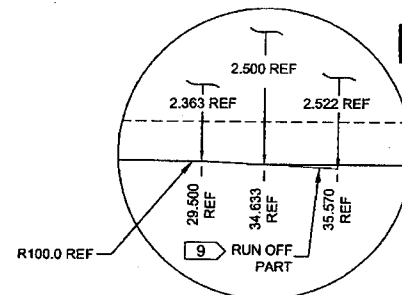

C4-4 **DETAIL N: TAPER RUN-OFF**
NOT TO SCALE

86W#11-615
11.07.28
UNDER REVIEW
11.06.13

DEO ATTACHED

RELEASED
2011-05-24

DESIGN	9	DART AEROSPACE LTD	
DRAWN	9	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D206-667-247	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSY (206L MID AFT)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD	

DRAWING NO. D206-667-247	TITLE CROSSTUBE ASS'Y (206L MID AFT)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D206-667-247-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 92	CHECKED ASS	MFG. APPR. KB	APPROVED JMP		DE APPR. #		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -247	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2892-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
JMP